


Quick Reference Guide

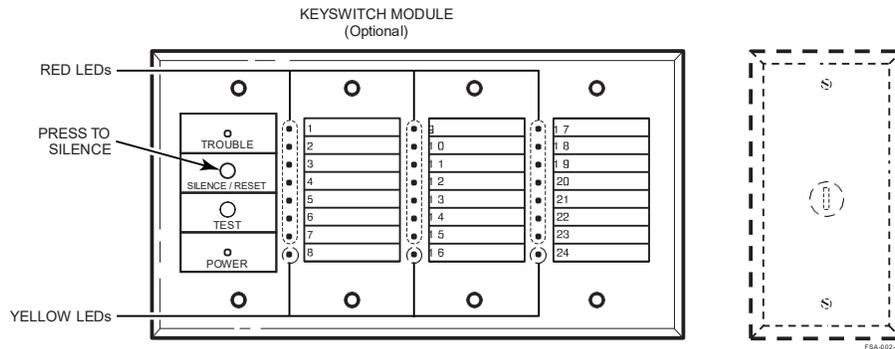

SILENCE / RESET SWITCH

First Press

- Silences the FSA's local sounder.
- Silences the FSA's local sounder and silences the Fire Partition's Notification Appliances.

Second Press

- Resets the Fire Partition.
- No affect.

Note to Installer - Please check options enabled.

KEYSWITCH (not programmable):

First Activation - Silences the Fire Partition's Notification Appliances including the FSA's local sounder.

Second Activation - Resets the Fire Partition.

Indicators

LED	STATE	INDICATION
Green (POWER)	Steady	AC power applied.
	Off	AC power source loss or AC power loss. Call for Service Immediately.
Yellow (TROUBLE)	Off	Normal state.
	Steady	System trouble detected, anything related to fire occurs (alarm, supervisory, trouble on a non-linked fire zone etc.), or in Service Mode.
	Flashing	Zone in trouble. Flashes in sync with zone (red) LED. Flashes if communication with panel is lost. NOTE: This occurs only if fire zone in trouble is mapped to this particular FSA.
Red (Zone) and Yellow (Fire troubles and Supervisory alarms)	Off	Normal state.
	Steady	Zone faulted or in alarm.
	Flashing	Zone in trouble. Flashes in sync with TROUBLE (yellow) LED.

Switches

SWITCH	FUNCTION
TEST	When pressed, sequentially lights all zone (red) LEDs to demonstrate operability.
SILENCE/RESET	When pressed, initiates sequence dependent upon programmed options. All options silence sounder for a period not to exceed 24 hrs.

Sounder

CONDITION	INDICATION
Sound steadily	Zone in alarm. Sound remains until manually silenced, locally or remotely, by user.
Beep rapidly	System/Zone in trouble.
Long, slow beep	Supervisory condition.



The product should not be disposed of with other household waste. Check for the nearest authorized collection centers or authorized recyclers. The correct disposal of end-of-life equipment will help prevent potential negative consequences for the environment and human health.

Any attempt to reverse-engineer this device by decoding proprietary protocols, de-compiling firmware, or any similar actions is strictly prohibited.

For Support visit: www.resideo.com.
For Warranty information visit: www.resideo.com.

This product is manufactured by Resideo Technologies, Inc. and its affiliates.



K4267-1V2B 11/05 Rev. B

resideo

2 Corporate Center Drive, Suite 100
P.O. Box 9040, Melville, NY 11747
© 2020 Resideo Technologies, Inc.
www.resideo.com